 


# Installation Instructions


## Connector Attachment

### For Braided Cable CNT400

### SMA male, Straight, Clamp-type Body




400PSM-HF

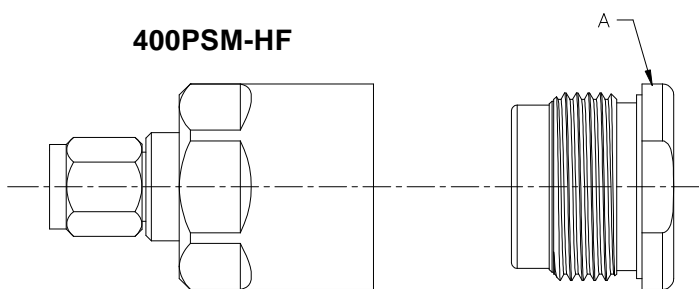


**1** Remove 6.50 mm (0.256") of Jacket only, exposing braided wire.

6.50 mm (0.256")

**2** Slide the part A onto the cable as shown.

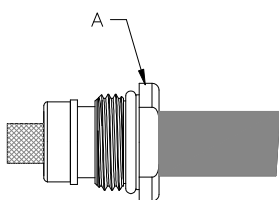


**3** Comb the braided wires to straight.

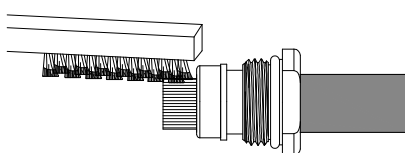


**5** Fold braided around part A and comb braid as shown, the braid should be straight and equally spaced after comb.

Braid


**6** Cut off the redundant braid as shown.

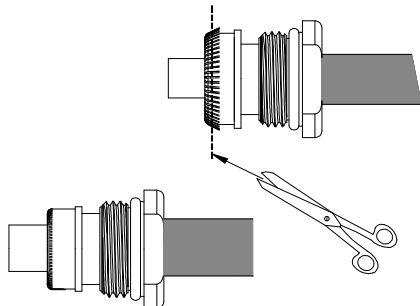


**7** Removed 5.0 mm (0.197") foam. Removed all foam/glue residue from the center conductor.

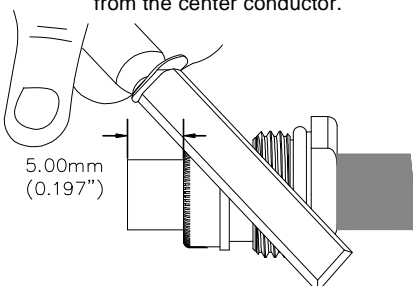

**8** Chamfer the center conductor at a 45° angle. It is very important.

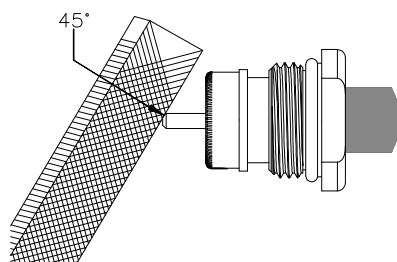

**9** The cable center conductor must be straight and aligned with the connector inner contact. Insert the cable into the connector body until stopped; the center conductor must be inserted into the connector inner contact holes. Tighten the connection to the torque value of 60-80 lb-in (6.8-9.0 N.m).  
Note: Do not turn connector body, turn cable attachment.

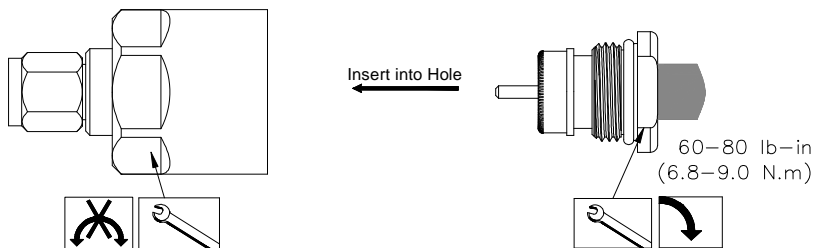

	表一 有毒有害物质或元素名称及含量标识格式					
	有毒有害物质或元素					
部件名称 (Part Name)	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr6+)	多溴联苯 (PBB)	多溴二苯醚 (PBDE)
连接器 (Connector)	X	O	O	O	O	O
<p>0: 表示有毒有害物质在该部件所有的均质材料中的含量均在SJ/T 11363-2006规定的限量要求以下。 X: 表示该有毒有害物质至少在该部件的某一均质材料中的含量超出SJ/T 11363-2006规定的限量要求。</p>						

**Installation Training Available at Andrew Institute**

Notice: Andrew disclaims any liability or responsibility for the results of improper or unsafe installation, in spection, maintenance, or removal practices



**Andrew Corporation**  
3 Westbrook Corporate Center, Suite 900, Westchester, Illinois U.S.A. 60154  
+1 (708) 349-3300 Fax (U.S.A.): 1-800-349-5444  
www.andrew.com  
Copyright © 2010 by Commscope Corporation

**Customer Service, 24 hours**  
U.S.A., Canada, Mexico: 1-800-255-1479  
U.K.: 0800 250055  
Other Europe: +44 592 782 612