 


# Installation Instructions

## Connector Attachment

For Braided Cable CNT300

N male, Right Angle, Clamp-type Body, IP68



**1** Remove 7.50 mm (0.295") of Jacket only, exposing braided wire.

**2** Slide the part A onto the cable as shown.

**3** Comb the braided wires to straight.

**5** Fold braided around part A and comb braid as shown, the braid should be straight and equally spaced after comb.

**6** Cut off the redundant braid as shown.

**7** Removed 6.0 mm (0.236") foam. Removed all foam/glue residue from the center conductor.

**8** Chamfer the center conductor at a 45° angle. It is very important.

**9** The cable center conductor must be straight and aligned with the connector inner contact. Insert the cable into the connector body until stopped; the center conductor must be inserted into the connector inner contact holes. Tighten the connection to the torque value of 60-80 lb-in (6.8-9.0 N.m). Note: Do not turn connector body, turn cable attachment.

	表一 有毒有害物质或元素名称及含量标识格式					
	有毒有害物质或元素					
部件名称 (Part Name)	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr6+)	多溴联苯 (PBB)	多溴二苯醚 (PBDE)
连接器 (Connector)	X	O	O	O	O	O

O: 表示有毒有害物质在该部件所有的均质材料中的含量均在SJ/T 11363-2006规定的限量要求以下。  
 X: 表示该有毒有害物质至少在该部件的某一均质材料中的含量超出SJ/T 11363-2006规定的限量要求。



**Installation Training Available at Andrew Institute**

Notice: Andrew disclaims any liability or responsibility for the results of improper or unsafe installation, in spection, maintenance, or removal practices

**Andrew Corporation**  
 3 Westbrook Corporate Center, Suite 900, Westchester, Illinois U.S.A. 60154  
 +1 (708) 349-3300 Fax (U.S.A.): 1-800-349-5444  
 www.andrew.com  
 Copyright © 2010 by Commscope Corporation

**Customer Service, 24 hours**  
 U.S.A., Canada, Mexico: 1-800-255-1479  
 U.K.: 0800 250055  
 Other Europe: +44 592 782 612