



L1HM-D Connector Installation for HELIAX® LDF1-50 Coaxial Cable

Bulletin 7723431 Revision D Page 1 of 2

CommScope Infrastructure Academy offers installation training.

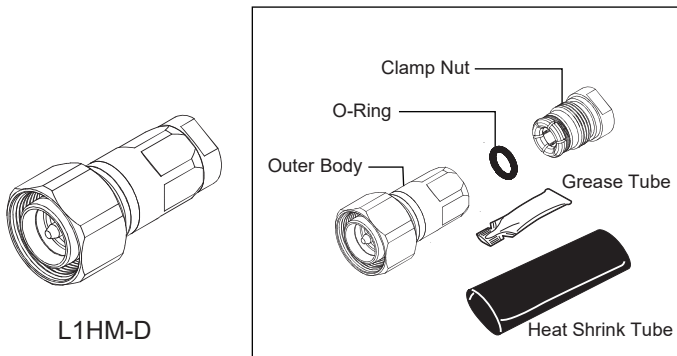

L1HM-D

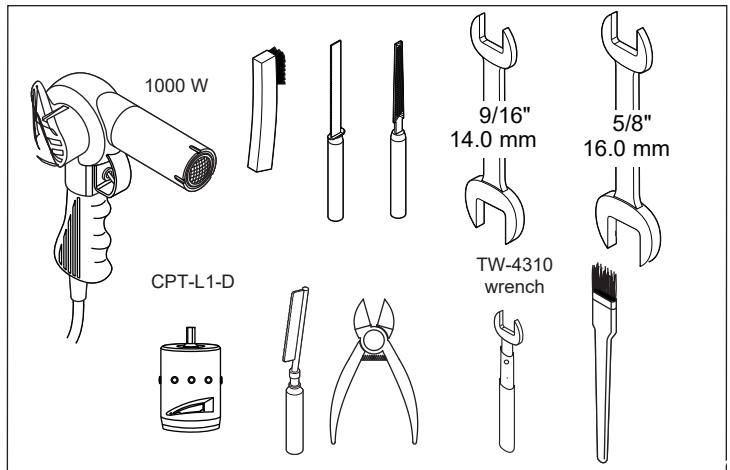

1 Straighten the cable and cut the end square using cable cutter.

6" (152 mm)

90°

WARNING
Outer conductor edges will be sharp

2 Apply forward pressure until the tool bottoms out. Reverse tool to remove. Clean up residual foam, and adhesive from cable inner conductor & cable foam.

1-1/16" 27 mm

Operating drill speed
250-650 rpm range

Prep tool Part Number:
CPT-L1-D

WARNING
No Floating Foam allowed

Floating Foam

3 Trim cable jacket.

0.630" (+1.0, -0.0) (16 mm)


4 Trim inner conductor, Remove foam and adhesive, taper inner conductor.

15/32" 11-12 mm
1/32" 1 mm x 45°

3 Enlarge the O-ring and insert onto cable outer conductor as shown. Apply a thin layer of grease to the o-ring.

1 2 3 4

4 Slide the clamping nut over the O-ring until it stops. Verify that the clamping nut has located into the first corrugation as shown.

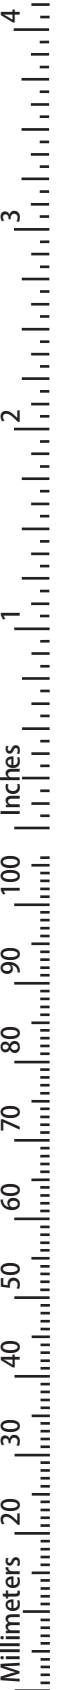


L1HM-D Connector Installation for HELIAX® LDF1-50 Coaxial Cable


Bulletin 7723431 Revision D Page 2 of 2

CommScope Infrastructure Academy offers installation training.


5 Remove all debris include inside edge and outer conductor. Compress the foam as shown.

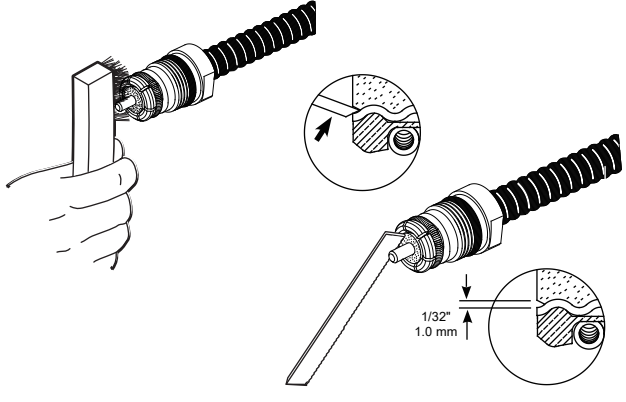


6 Slide the outer body up to the clamping nut and tighten by hand by turning the clamping nut and holding the outer body. Complete the installation by open ended wrenches as shown.

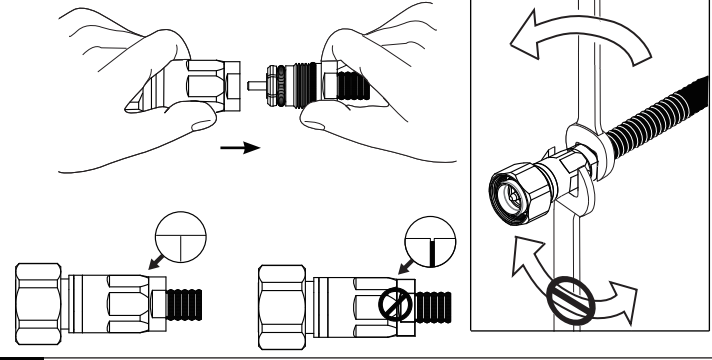

7 Apply heat shrink tube.

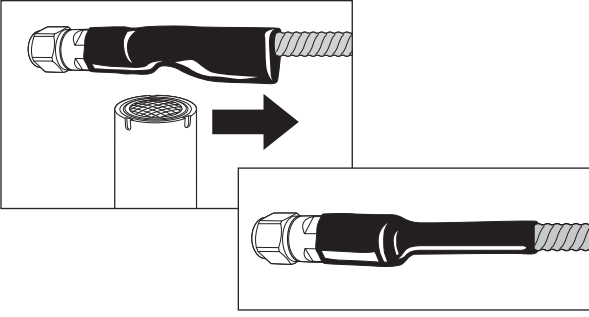


8 Tighten the coupling nut to the proper torque specification.

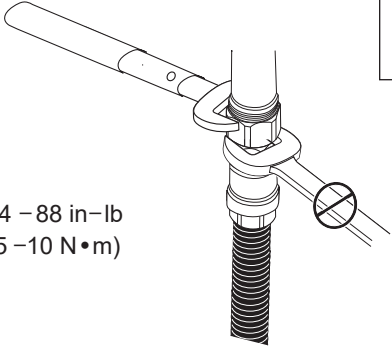

Torque wrench
Part Number:
TW-4310

44 – 88 in-lb
(5 – 10 N•m)

	表一 有毒有害物质或元素名称及含量标识格式					
	有毒有害物质或元素					
部件名称 (Part Name)	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr6+)	多溴联苯 (PBB)	多溴二苯醚 (PBDE)
连接器 (Connector)	X	O	O	O	O	O
<p>O: 表示有毒有害物质在该部件所有的均质材料中的含量均在SJ/T 11363-2006规定的限量要求以下。 X: 表示该有毒有害物质至少在该部件的某一均质材料中的含量超出SJ/T 11363-2006规定的限量要求。</p>						

CommScope
3642 E US Highway 70, Claremont, NC 28610 USA
(828) 324-2200 (800) 982-1708
www.commscope.com

Customer Service 24 hours
North America: +1-800-255-1479 (toll free)
Any country: +1-779-435-6500
email: acicustomersupportcenter@commscope.com

Notice: CommScope disclaims any liability or responsibility for the results of improper or unsafe installation, inspection, maintenance, or removal practices.
Aviso: CommScope no acepta ninguna obligación ni responsabilidad como resultado de prácticas incorrectas o peligrosas de instalación, inspección, mantenimiento o retiro.
Avis: CommScope décline toute responsabilité pour les conséquences de procédures d'installation, d'inspection, d'entretien ou de retrait incorrectes ou dangereuses.
Hinweis: CommScope lehnt jede Haftung oder Verantwortung für Schäden ab, die aufgrund unsachgemäßer Installation, Überprüfung, Wartung oder Demontage auftreten.
Atenção: A CommScope abdica do direito de toda responsabilidade pelos resultados de práticas inadequadas e sem segurança de instalação, inspeção, manutenção ou remoção.
Avvertenza: CommScope declina eventuali responsabilità derivanti dall'esecuzione di procedure di installazione, ispezione, manutenzione e smontaggio improprie o poco sicure.
注意: CommScope 公司申明對於不恰當或不安全的安裝、檢驗、維修或拆卸操作所導致的後果不負任何義務和責任